

Mt Robson Visitors Centre ▼

Information

Date of Audit: 2016-08-26

Park Name: Fisheries Pool Campground

Key Features: Camping,Picnic\_Site,Beach,Fishing

Location: Central Coast, Bella Coola, Cariboo Chilcotin Coast - Provincial : Campground (Discovery Coast Circle Route)

Description: Very popular salmon fishing spot with small beach. Small picnic area (two non-accessible tables) on river bank gives a nice view of river (see additional picture)

Parking

Access Routes

**From:** : Parking lot in front of stairs to "accessible "outhouse

**To:** : "Accessible" Outhouse

**Comments/Description** : Route is 50 metres long and the surface after leaving the parking lot is very uneven and steep with protruding roots and rocks. This is not an accessible route to the washroom.

**Recommendations** : Improve surface and slope (not a cheap fix)

**Improvement Priority** : High

**Estimated Cost** : High

**2. What is the condition of the surface along this route?** : Good

**4. What is the type of surface?** : Gravel

**Comments/Description** : Graveled parking lot, gravel and dirt closer to outhouse. Could be very muddy when wet.

**Clear Width**

**5. What is the typical route width (mm)?** : More\_than\_1525 (Rating: 0)

**Comments/Description** : 2700 mm

**6. What is the narrowest route width (mm)?** : More\_than\_1525 (Rating: 0)

**Comments/Description** : 1700 mm

**Obstacles**

**7. If the route is concrete, asphalt or boardwalk, are there any obstacles that exceed 13mm from the surface?** : N\_A (Rating: 0)

**8. If yes, are the obstacles at least 1220mm apart?** : N\_A (Rating: 0)

**9. If the route is anything other than concrete, asphalt or boardwalk, are there any obstacles that exceed**

**25mm from the surface? : No (Rating: 0)**

**Comments/Description : Protruding tree roots and rocks make for a rough surface**

**10. If yes, are the obstacles at least 1220mm apart? : N\_A (Rating: 0)**

### **Openings**

**11. Are there any gaps or grates present that have an opening greater than 13mm? : No (Rating: 0)**

**12. If gaps/grates are present, do they run perpendicular to the path of travel? : N\_A (Rating: 0)**

### **Running Slope**

**13. What is the typical running slope on the route? : Steep\_3\_-\_5 (Rating: 0)**

**Comments/Description : 4 degrees**

**14. What is the maximum running slope on the route? : Very\_steep\_above\_5 (Rating: 0)**

**Comments/Description : 6 degrees**

### **Cross Slope**

**15. What is the typical cross slope on the route? : Moderate\_2\_-\_3 (Rating: 1)**

**Comments/Description : 3 degrees**

**16. What is the maximum cross slope on the route? : Steep\_3\_-\_5 (Rating: 0)**

**Comments/Description : 5 degrees**

### **Resting Intervals**

**17. Are there resting intervals at the top and bottom of a route where the grade exceeds 3°? : No (Rating: 0)**

**18. If the running slope is greater than 3°, are there resting intervals in the middle of the route when the length exceeds 9.1m? : No (Rating: 0)**

### **Benches**

**21. Are there any benches along the route? : No (Rating: 0)**

**22. If yes, are the benches located approximately every 61m? : N\_A (Rating: 0)**

**23. Is the bench seat height between 485mm - 510mm? : N\_A (Rating: 0)**

### **Ramps**

**24. Is there is a ramp? : No (Rating: 0)**

**25. Is the ramp at least 915mm wide?**

**Note: If there are handrails, measure between the handrails. : N\_A (Rating: 0)**

**26. Is the surface stable, firm and slip resistant? : N\_A (Rating: 0)**

**27. For each section of the ramp, is the running slope no greater than 5°?**

**Note: Rises no greater than 76mm with a slope no steeper than 7° and rises no greater than 150mm with a slope no steeper than 6° are permitted when due to space limitations. : N\_A (Rating: 0)**

**28. Is there a level landing that is at least 1525mm long and at least as wide as the ramp: At the top of the ramp? : N\_A (Rating: 0)**

**29. At the bottom of the ramp? : N\_A (Rating: 0)**

**30. Is there a level landing where the ramp changes direction that is at least 1525mm x 1525mm? : N\_A (Rating: 0)**

**31. If the ramp has a rise higher than 150mm are there handrails on both sides? : N\_A (Rating: 0)**

**32. Is the top of the handrail gripping surface no less than 865mm and no greater than 965mm above the ramp surface? : N\_A (Rating: 0)**

**33. Is the handrail gripping surface continuous and not obstructed along the top or sides? : N\_A (Rating: 0)**

**34. If there are obstructions, is the bottom of the gripping surface obstructed no more than 20%? : N\_A (Rating: 0)**

## **Stairs**

**35. Are there floors or surfaces connected only by stairs, not an elevator or ramp? : No (Rating: 0)**

**Comments/Description : Stairs provide an alternate route from parking lot to "accessible" outhouse**

**36. How many flights of stairs are there? : N\_A**

**37. If there are less than a flight, how many stairs are there? : N\_A**

**38. Do all stair treads have a horizontal strip at the edge that is: 40mm-60mm deep, colour contrasted & extends the full width of the step? : N\_A (Rating: 0)**

**39. If the stairs are not enclosed, is there a tactile warning system present at the landing of entrance to stairs system? : N\_A (Rating: 0)**

**40. Are there handrails on both sides of the stairs at a uniform height of 860mm-920mm above the front step? : N\_A (Rating: 0)**

**41. Do the handrails extend horizontally at the top and bottom of each flight of stairs? : N\_A (Rating: 0)**

**42. Are the handrails continuous around landings? : N\_A (Rating: 0)**

**43. Are the handrails continuously graspable, without interruption by vertical supports, newel posts, or other construction elements which require repositioning the hands while ascending or descending? : N\_A (Rating: 0)**

**44. Do the handrails have a graspable cross-section that is either circular with an outside diameter of 30mm-40mm or elliptical with an outside perimeter of 100mm-125mm? : N\_A (Rating: 0)**

Trails

Washrooms

**Date of Audit : 2016-08-26**


**Auditors Names : Bob**

**Weather condition during audit : Sunny**

**Washroom # : 1**

**Description of washroom location : Just above parking lot, close to river**

**Type of Washroom : Out-house**

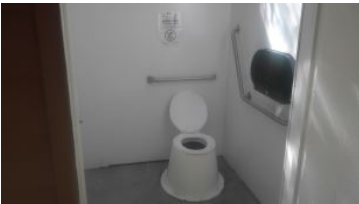

**1. If washrooms are available to the public, is at least one washroom designated as accessible? (Either one for each sex, or one unisex.) : Yes (Rating: 1)**

**Comments/Description : 3 outhouses in total, one accessible outhouse**

**Directional signage**

**2. Are there signs at inaccessible washrooms that give directions to accessible washrooms? : No (Rating: 0)**

**3. Is there an accessible route to the accessible washroom? : No (Rating: 0)**

**Comments/Description : Route is 50 m from parking lot in front of stairs to outhouse. Surface is firm (gravel and dirt), max 6 degree running slope, but has lot of rocks and tree roots. 15 mm lip from gravel surface to concrete pad.**

**Recommendations : Improve accessibility to outhouse (not a simple task) or relocate outhouse.**

**Improvement Priority : High**

**Estimated Cost : High**

**4. If not all washrooms are accessible, is there a sign at the accessible washroom with the International Symbol of Accessibility? : Yes (Rating: 1)**

**Comments/Description** : On side of outhouse facing access route. Door not visible until you are right at it.

**Recommendations** : Also place sign on wall on latch side of door

**Improvement Priority** : Med

**Estimated Cost** : Low

**5. Do text characters contrast with their backgrounds?** : Yes (Rating: 1)

**Comments/Description** : White lettering on brown background

**Recommendations** : White on blue would stand out better against the brown building

**Improvement Priority** : Med

**Estimated Cost** : Low

**6. Are text characters raised?** : No (Rating: 0)

**7. Is there Braille?** : No (Rating: 0)

**8. Is the sign mounted on the wall, on latch side of the door?**

**Note: Signs are permitted on the push side of doors with closers and without hold-open devices.** : No (Rating: 0)

**Comments/Description** : Sign located on side of outhouse

**Recommendations** : Place sign in this location as well

**Improvement Priority** : Med

**Estimated Cost** : Low

**9. So the baseline of the lowest character is at least 1220mm above the floor and the baseline of the highest character is no more than 1525mm above the floor?**

**Note: If the sign is at double doors with one active leaf, the sign should be on the inactive leaf; if both leaves are active, the sign should be on the wall to the right of the right leaf.** : Yes (Rating: 1)

**Measurement**  
(mm) : 1400

**Interior doors**

**10. Is the door opening width at least 815mm clear, between the face of the door and the stop, when the door is open 90°?** : N\_A (Rating: 0)

**11. If there is a front approach to the pull side of the door, is there at least 455mm of maneuvering clearance beyond the latch side plus at least 1525mm clear depth?** : N\_A (Rating: 0)

**12. On both sides of the door, is the floor surface of the maneuvering clearance level (no steeper than 1°)?** : N\_A (Rating: 0)

**13. If the threshold is vertical is it no more than 6mm high?**

**Or : N\_A (Rating: 0)**

**14. If the threshold is beveled, is it no more than 19mm high? : N\_A (Rating: 0)**

**15. Is the door equipped with hardware that is operable with one hand and does not require tight grasping, pinching or twisting of the wrist? : N\_A (Rating: 0)**

**16. Are the operable parts of the hardware no less than 865mm and no greater than 1220mm above the floor? : N\_A (Rating: 0)**

**17. Can the door be opened easily, maximum 2.3kg of force?**

**Note: You can use a pressure gauge or fish scale to measure force. : Yes (Rating: 1)**

**Measurement  
(kg) : 0.5**

**Comments/Description : outhouse door**

**18. If the door has a closer, does it take at least 5 seconds to close from open position of 90° to a position of 12° from the latch? : Yes (Rating: 1)**

**Measurement  
(seconds) : 8**

**Comments/Description : outhouse door**

**19. If there are two doors in a series, e.g. vestibule, is the distance between the doors at least 1220mm plus the width of the doors when swinging into the space? : N\_A (Rating: 0)**

**20. If there is a privacy wall and the door swings out, is there at least 610mm of maneuvering clearance beyond the door latch side and 1065mm to the privacy wall? : N\_A (Rating: 0)**

**21. If there is a privacy wall and the door swings in, is there at least 610mm of maneuvering clearance beyond the door latch side and at least 1220mm to the privacy wall if there is no door closer or at least 1370mm if there is a door closer? : N\_A (Rating: 0)**

**22. In a unisex washroom if the door swings in and over a clear floor space at an accessible fixture, is there a clear floor space at least 760mm x 1220mm beyond the swing of the door? : N\_A (Rating: 0)**

**Toilet stall**

**23. Is there an individual accessible toilet stall? : Yes (Rating: 1)**

**24. Is the stall door opening width at least 815mm clear, between the face of the door and the stop, when the door is open 90°? : Yes (Rating: 1)**

**Measurement  
(mm) : 880**

**Clearance  
(mm) : 295**

**Depth**  
**(mm) : 1700**

**26. Is the door self-closing? : Yes (Rating: 1)**

**27. Are there door pulls on both sides of the door that are operable with one hand and do not require tight grasping pinching or twisting of the wrist?\* : Yes (Rating: 1)**

**Comments/Description : Small D handle on exterior, 910 mm long grab bar (on angle) on interior of door**

**Recommendations : Replace exterior handle with a larger D handle**

**Improvement Priority : High**

**Estimated Cost : Low**

**28. Is the lock operable with one hand and without tight grasping, pinching or twisting of the wrist? : No (Rating: 0)**

**Comments/Description : Large hook and eye latch 1025 mm above floor**

**Recommendations : Replace with a latch that is easier to operate (e.g. a sliding lock)**

**Improvement Priority : High**

**Estimated Cost : Low**

**29. Are the operable parts of the door hardware mounted no less than 865mm and no greater than 1220mm above the floor? : Yes (Rating: 1)**

**Measurement**  
**(mm) : 920**

**Comments/Description : 920 mm to exterior D handle. Grab bar on interior max. 1160 mm and min. 370 mm above floor**

**30. Is the stall at least 1525mm wide? : No (Rating: 0)**

**Measurement**  
**(mm) : 1500**

**31. If the toilet is wall hung, is the stall at least 1420mm deep?**

**Or : N\_A (Rating: 0)**

**32. If the toilet is floor mounted, is the stall at least 1500mm deep? : Yes (Rating: 1)**

**Measurement**  
**(mm) : 1505**

**If the door swings in, is the stall area beyond the swing of the door:**

**33. A minimum of 1525mm wide x 1420mm deep for wall hung toilet?**

**Or : N\_A (Rating: 0)**

**34. A minimum of 1525mm wide x 1500mm deep for floor mounted toilet? : N\_A (Rating: 0)**

**Comments/Description : door swings out**

#### **Toilet**

**35. Is the centerline of the toilet no less than 405mm and no greater than 455mm from the side wall or partition? : Yes (Rating: 1)**

**Measurement  
(mm) : 450**

**36. Is clearance provided around the toilet measuring at least 1525mm from the side wall and at least 1420mm from the rear wall? : No (Rating: 0)**

**From side wall  
(mm) : 1500**

**From rear wall  
(mm) : 1505**

**Comments/Description : 1500 mm W x 1505 mm D CLOSE TO STANDARD - OK**

**37. Is the height of the toilet no less than 430mm and no greater than 485mm above the floor measured to the top of the seat? : No (Rating: 0)**

**Measurement  
(mm) : 400**

**Recommendations : Consider replacing or raising toilet to bring height up to standard**

**Improvement Priority : High**

**Estimated Cost : Med**

#### **Grab bars**

**38. Is there a grab bar at least 1065mm long on the side wall? : No (Rating: 0)**

**Comments/Description : Angled grab bar. Angled section (600 mm long) closest to rear wall, horizontal section is 610 mm long) (see picture).**

**Recommendations : Replace with long straight properly positioned grab bar to meet standard.**

**Improvement Priority : High**

**Estimated Cost : Low**

**39. Is it located no more than 305mm from the rear wall? : No (Rating: 0)**

**Measurement**



**(mm) : 510**

**Comments/Description : 510 mm from rear wall to beginning of horizontal section**

**40. Does it extend at least 1370mm from the rear wall? : No (Rating: 0)**

**Measurement**

**(mm) : 1220**

**Comments/Description : 1220 mm from rear wall to end of horizontal section**

**41. Is it mounted no less than 840mm and no greater than 915mm above the floor to the top of the gripping surface? : No (Rating: 0)**

**Measurement**

**(mm) : 780**

**Comments/Description : 780 mm from floor to top of gripping surface on horizontal section. Top of angled section is 1295 mm above floor**

**Improvement Priority : N\_A**

**Estimated Cost : N\_A**

**42. Is there at least 305mm clearance between the grab bar and protruding objects above? : No (Rating: 0)**

**Measurement**

**(mm) : 140**

**Comments/Description : 140 mm from top of grab bar to bottom of TP dispenser**

**Recommendations : Raise dispenser to meet standard**

**Improvement Priority : Med**

**Estimated Cost : Low**

**43. Is there at least 38mm clearance between the grab bar and projecting objects below? : N\_A (Rating: 0)**

**44. Is the space between the wall and the grab bar 38mm : Yes (Rating: 1)**

**Measurement**

**(mm) : 40**

**45. Is there a grab bar at least 915mm long on the rear wall? : No (Rating: 0)**

**Measurement**

**(mm) : 610**

**Recommendations : Replace with longer grab bar to meet standard**

**Improvement Priority : High**

**Estimated Cost : Low**

**46. Does the grab bar extend at least 305mm from the centerline of the toilet on one side (side wall)? : Yes**  
(Rating: 1)

**Measurement**  
(mm) : 305

**47. Does the grab bar extend at least 610mm on the other (open) side? : No** (Rating: 0)

**Measurement**  
(mm) : 305

**48. Is the grab bar mounted no less than 840mm and no greater than 915mm above the floor to the top of the gripping surface? : Yes** (Rating: 1)

**Measurement**  
(mm) : 855

**49. Are there at least 305mm clearance between the grab bar and protruding objects above? : N\_A**  
(Rating: 0)

**50. Are there at least 38mm clearance between the grab bar and projecting objects below? : N\_A** (Rating: 0)

**51. Is the space between the wall and the grab bar 38mm inches? : Yes** (Rating: 1)

**Measurement**  
(mm) : 40

#### **Toilet flush controls**

**52. If the flush control is hand operated, is the operable part located no higher than 1220mm above the floor? : N\_A** (Rating: 0)

**53. If the flush control is hand operated, can it be operated with one hand and without tight grasping, pinching, or twisting of the wrist? : N\_A** (Rating: 0)

**54. Is the force required to activate the flush control no greater than 2.3kg? : N\_A** (Rating: 0)

**55. Is the flush control on the open side of the toilet? : N\_A** (Rating: 0)

#### **Toilet paper dispenser**

**56. Is the toilet paper dispenser located no less than 180mm and no greater than 230mm from the front of the toilet to the center line of the dispenser? : No** (Rating: 0)

**Measurement**  
(mm) : 380

**Recommendations** : Re-position dispenser

**Improvement Priority** : High

**Estimated Cost** : Low

**57. Is the outlet of the dispenser: Located no less than 380mm and no greater than 1220mm above the floor? : Yes (Rating: 1)**

**Measurement  
(mm) : 920**

**58. Is the dispenser located behind grab bars? : No (Rating: 0)**

**59. Does the dispenser allow continuous paper flow? : Yes (Rating: 1)**

### **Sink**

**60. Does at least one sink have a clear floor space for a forward approach at least 760mm wide and 1220mm long? : N\_A (Rating: 0)**

**61. Do no less than 430mm and no greater than 635mm of the clear floor space extend under the sink so that a person using a wheelchair can get close enough to reach the faucet? : N\_A (Rating: 0)**

**62. Is the front of the sink or counter surface, whichever is higher, no more than 865mm above the floor? : N\_A (Rating: 0)**

**63. Is there at least 685mm height clearance from the floor to the bottom of the sink that extends at least 205mm deep under the sink for knee clearance? : N\_A (Rating: 0)**

**64. Is there toe clearance at least 230mm high?**

**Note: Space extending greater than 150mm beyond the available toe clearance at 230mm above the floor is not considered toe clearance. : N\_A (Rating: 0)**

**65. Are pipes below the sink insulated or otherwise configured to protect against contact? : N\_A (Rating: 0)**

**66. Can the faucet be operated without tight grasping, pinching, or twisting of the wrist? : N\_A (Rating: 0)**

**67. Is the force required to activate the faucet no greater than 2.3 kg? : N\_A (Rating: 0)**

### **Washroom fixtures**

**68. Is there a clear path to at least one of each type of fixture, e.g. sink, hand dryer, garbage bin etc., that is at least 915mm wide? : N\_A (Rating: 0)**

**69. Is there clear floor space available for a person in a wheelchair to turn around, i.e. a circle at least 1525mm in diameter or a T-shaped space within a 1525mm square? : N\_A (Rating: 0)**

### **Mirror**

**70. If the mirror is over a sink or countertop, is the bottom edge of the reflecting surface no higher than 1015mm above the floor?**

**Or : N\_A (Rating: 0)**

**71. If the mirror is not over the sink or countertop, is the bottom edge of the reflecting surface no higher than 890mm above the floor? : N\_A (Rating: 0)**

**Coat hook**

**72. If there is a coat hook, is it no less than 380mm and no greater than 1220mm above the floor?\*** : Yes  
(Rating: 1)

**Measurement  
(mm) :** 1695

**Comments/Description :** 1695 mm above floor, wood screw painted white

**Recommendations :** Replace with proper coat hook

**Improvement Priority :** Med

**Estimated Cost :** Low

**Soap dispenser**

**Are the operable parts of the soap dispenser within one of the following reach ranges:**

**73. Above sinks or counters no less than 510mm and no greater than 635mm deep: no higher than 1120mm above the floor?**

**Or :** N\_A (Rating: 0)

**74. Above sinks less than 510mm deep: no higher than 1220mm above the floor?**

**Or :** N\_A (Rating: 0)

**75. Not over an obstruction: no higher than 1220mm above the floor? :** N\_A (Rating: 0)

**Hand dryer/Towel dispenser**

**Are the operable parts of the hand dryer or towel dispenser within one of the following reach ranges:**

**76. Above sinks or counters no less than 510mm and no greater than 635mm deep: no higher than 1120mm above the floor?**

**Or :** N\_A (Rating: 0)

**77. Above sinks less than 510mm deep: no higher than 1220mm above the floor?**

**Or :** N\_A (Rating: 0)

**78. Not over an obstruction: no higher than 1220mm above the floor? :** N\_A (Rating: 0)

**79. Can the operable parts of the hand dryer or towel dispenser be operated without tight grasping, pinching or twisting of the wrist? :** N\_A (Rating: 0)

**80. Is the force required to activate the hand dryer or towel dispenser no greater than 2.3kg? :** N\_A  
(Rating: 0)

**Controls - light switches**

**81. Is there a clear floor space at least 760mm wide by at least 1220mm long for a forward or parallel approach? : N\_A (Rating: 0)**

**82. Are the operable parts no higher than 1220mm above the floor? : N\_A (Rating: 0)**

**83. Can the control be operated with one hand and without tight grasping, pinching, or twisting of the wrist? : N\_A (Rating: 0)**

**1. Has the route to the washroom been evaluated? : Yes**

**Additional comments regarding assessment:** : Outhouse building itself is fairly accessible, except for the grab bars. The route to the outhouse is not accessible.



**Description of Photo 1 :** Inside of door to accessible outhouse



**Description of Photo 2 :** Access route to accessible outhouse. Max running slope 6 degrees, uneven surface due to roots and rocks

Camping

**Date of Audit (YYYY-MM-DD) :** 2016-08-26

**Name of Campground :** Fisheries Pool Campground (Tweedsmuir (South) Provincial Park)

**Location of Campsite :** No designated accessible campsites, #4 (RV site) shown below as example

**Weather condition during audit :** Sunny



**1. Does the number of accessible camp sites comply with the table above? :** No\_ \_Below\_Standard (Rating: 0)

**Comments/Description :** No designated accessible sites. 14 in total, 9 are RV/trailer stalls which are firm and level (less than 2 degrees running and cross slopes) and could be considered accessible. #4 (shown above) is 4.92 m wide and 10.6 m long

**Recommendations :** Consider designating 2 RV stalls as wheelchair accessible to meet standard

**Improvement Priority :** High

**Estimated Cost :** Low

### Campsite

**2. Is the camp site surface firm and stable? :** Yes (Rating: 1)

**3. What type of surface is in the campsite? :** Gravel

**4. Is the accessible campsite at least 4.9m wide?**

**Or :** N\_A (Rating: 0)

**5. If it is an RV site, is the parking area at least 6m wide? :** No\_ \_Below\_Standard (Rating: 0)

### Measurement

**(m) :** 5

**Comments/Description :** Not "accessible". See Question 1 above

**6. If the campsite surface is concrete or asphalt, is the slope 1° or less? :** N\_A (Rating: 0)

**7. If the campsite surface is anything other than concrete & asphalt, is the slope 3° or less? :** Yes\_ \_Exceeds\_Standard

### Tent Pads/Platforms

**8. Is there a minimum of 1220mm clear space on all sides surrounding the tent pad or platform? :** N\_A (Rating: 0)

**Comments/Description :** N/A

**10. What is the slope of the tent pad/ platform? :** N\_A (Rating: 0)

**11. Is there an accessible entrance or ramp on to the tent pad/platform? :** N\_A (Rating: 0)

### Utility & Sewage Hook Ups

**12. Is there sufficient clear ground space, a minimum of 1220mm x 1525mm surrounding the hook ups? :** N\_A (Rating: 0)

**13. If there are operable parts, can they be operated using one hand, without tightly grasping, pinching, or twisting the wrist and with no more than 2.3kg of force? :** N\_A (Rating: 0)

**Campfires & Grills**

**14. Is there an area for campfires? : Yes (Rating: 1)**

**Comments/Description :** Fire ring

**15. Is there a minimum of 1220mm clear ground space on all sides? : Yes - Exceeds Standard**

**Measurement  
(mm) :** 1450

**16. Is the slope 3° or less in all directions? : Yes (Rating: 1)**

**Measurement  
(angle °) :** 2

**Comments/Description :** 2 degrees average (max. 2.5 degrees)

**17. Is the grill height between 380mm - 865mm above the ground? : No (Rating: 0)**

**Measurement  
(mm) :** 330

**18. Is the fire building surface height at least 230mm above the ground? : No (Rating: 0)**

**Measurement  
(mm) :** 190

**19. If there is a raised edge or wall around the fire building area, is the thickness less than 255mm? : N\_A  
(Rating: 0)**

**20. Is there a clear, level accessible route to the campfire area? : Yes (Rating: 1)**

**21. Are picnic tables provided? : Yes (Rating: 1)**

**Comments/Description :** Each RV/trailer site has a picnic table and fire ring.

**22. How many accessible picnic tables are there? : N\_A**

**Comments/Description :** no accessible tables

**23. If the picnic table is up to 2.7m long, is there one wheelchair seating space? : N\_A (Rating: 0)**

**24. If the picnic table is longer than 2.7m, are there at least two wheelchair spaces provided? : N\_A  
(Rating: 0)**

**25. Is there clear and level ground space, 915mm measured from back edge of seats/benches? : N\_A  
(Rating: 0)**

**26. Do the accessible spaces have adequate knee clearance, 685mm high x 760mm wide x 430mm deep? :  
N\_A (Rating: 0)**

**27. Is the ground surface surrounding the accessible picnic table firm and stable? : N\_A (Rating: 0)**

**28. Is there a clear, level accessible route to the picnic table? : N\_A (Rating: 0)**

**Comments/Description :** Surface surrounding existing non-accessible table is firm, stable and level so this would be a good location for an accessible table.

**Recommendations :** Replace current table with an accessible one at two campsites

**Improvement Priority :** High

**Estimated Cost :** Med

### **Water Taps**

**1. Are there any water taps? : Yes (Rating: 1)**

**Comments/Description :** Water pump located 4 metres from edge of road and next to picnic shelter. Space between large rock obstacles is 1600 mm

**Recommendations :** Consider installing a water tap that is easier to operate, especially for a disabled person.

**2. Is there sufficient clear ground space, a minimum of 1829mm x 1220mm surrounding the water tap? : Yes - Exceeds Standard**

### **Measurement**

**(mm x mm) :** 2000 x 1400

**3. Is the water spout height between 280mm - 305mm? : No (Rating: 0)**

### **Measurement**

**(mm) :** 770

**4. Is the height of operable parts (i.e. taps or levers) between 380mm - 1220mm above the ground? : No (Rating: 0)**

### **Measurement**

**(mm) :** 1860

**Comments/Description :** Handle is 1860 mm above ground when fully raised

**Recommendations :** See above

**Improvement Priority :** High

**Estimated Cost :** High

**5. If there are operable parts, can they be operated using one hand, without tightly grasping, pinching, or twisting the wrist and with no more than 2.3kg of force? : No (Rating: 0)**

**Comments/Description :** 10 kg force required

**Recommendations :** See above

**Improvement Priority :** High



**Estimated Cost** : High

**6. Is there a clear, level accessible route to the water tap?** : Yes (Rating: 1)

**Comments/Description** : firm graveled surface, less than 2 degrees running and cross slopes

#### **Water Fountains**

**1. Is there a water fountain?** : No (Rating: 0)

**2. Does it have a lever or push bar control on the front or both sides?** : N\_A (Rating: 0)

**3. Is the spout opening height between 750mm - 915mm above the ground?** : N\_A (Rating: 0)

**4. Is there a minimum width of 800mm clearance space directly in front of the water fountain?** : N\_A (Rating: 0)

**5. Is there a clear, level accessible route to the water fountain?** : N\_A (Rating: 0)

#### **Trash & Recycling Receptacles**

**1. Are there any trash &/or recycling receptacles?** : Yes (Rating: 1)

**Comments/Description** : "Bear-proof" receptacle. Located close to water pump and 4 metres from road surface

**2. Is the approach to the receptacle level, with no-step?** : Yes (Rating: 1)

**Comments/Description** : Typically less than 1 degree running and cross slopes. Max. running slope 3 degrees. Firm graveled surface

**3. If there are operable parts, is their height between 380mm - 1220mm above the ground?** : Yes (Rating: 1)

**Measurement (mm)** : 1000

**4. If there are operable parts, can they be operated using one hand, without tightly grasping, pinching, or twisting the wrist and with no more than 2.3kg of force?** : No (Rating: 0)

**Comments/Description** : 4 kg force required (typical for these receptacles)

**5. Is there a clear, level accessible route to the trash/recycling receptacle?** : Yes (Rating: 1)

#### **Shelters**

**1. Are there any camp shelters?** : Yes (Rating: 1)

**2. What is the slope at the entrance to the camp shelter?** : Moderate\_2\_-\_3 (Rating: 1)

**Comments/Description** : 3.5 metres from road surface to shelter entrance, typical running slope less than 2 degrees, max. 7 degrees for about 1.5 metres

**Recommendations** : make access route more gentle

**Improvement Priority : Med**

**Estimated Cost : Med**

**3. What type of surface is in the camp shelter? : Concrete**

**4. Is the shelter surface firm and stable? : Yes (Rating: 1)**

**Comments/Description : No accessible picnic tables in the shelter**

**5. Is there a clear, level accessible route to the camp shelter? : Yes (Rating: 1)**

**Comments/Description : Short steep slope,for 1.5 m, otherwise a good route (see above)**

### **Benches**

**1. Are any benches provided? : No (Rating: 0)**

**2. If yes, how many benches are there? : N\_A**

**3. Is the bench seat height between 485mm - 510mm? : N\_A (Rating: 0)**

**4. Is there a minimum of 915mm x 1220mm clear ground space beside the bench? : N\_A (Rating: 0)**

**5. Is there a clear, level accessible route to the bench? : N\_A (Rating: 0)**

### **Playground**

**1. Is there a playground? : No (Rating: 0)**

**2 What type of surface is in the play area? : N\_A**

**3. Is the play area surface firm and stable? : N\_A (Rating: 0)**

**4. Are any of the playground components accessible to wheelchair users? If yes, please describe. : N\_A (Rating: 0)**

**5. Is there a clear, level accessible route to the playground? : N\_A (Rating: 0)**

### **Amphitheatre**

**1. Is there an amphitheatre? : No (Rating: 0)**

### **Amphitheatre Seating**

**2. Are an adequate number of wheelchair spaces provided? : N\_A (Rating: 0)**

**3. Are wheelchair spaces dispersed to allow location choices and viewing angles equivalent to other seating, including specialty seating areas that provide distinct services and amenities? : N\_A (Rating: 0)**

**4. Where people are expected to remain seated, do people in wheelchair spaces have a clear line of sight over and between the heads of others in front of them? : N\_A (Rating: 0)**

**5. Where people are expected to stand, do people in wheelchair spaces have a clear line of sight over and**

**between the heads heads of others in front of them? : N\_A (Rating: 0)**

**6. If there is a single wheelchair space, is it at least 915mm wide? : N\_A (Rating: 0)**

**7. If there are two adjacent wheelchair spaces, are they each at least 840mm wide? : N\_A (Rating: 0)**

**8. If the wheelchair space can be entered from the front or rear, is it at least 1220mm deep? : N\_A (Rating: 0)**

**9. If the wheelchair space can only be entered from the side, is it at least 1525mm deep? : N\_A (Rating: 0)**

**10. Do wheelchair spaces adjoin, but not overlap, accessible routes? : N\_A (Rating: 0)**

**11. Is there at least one companion seat for each wheelchair space? : N\_A (Rating: 0)**

**12. Is the companion seat located so the companion is shoulder-to-shoulder with the person in a wheelchair? : N\_A (Rating: 0)**

**13. Is the companion seat equivalent in size, quality, comfort and amenities to seating in the immediate area? : N\_A (Rating: 0)**

**2. Are there any public buildings (visitors centre/ interpretive centre/cafes etc) at the campground? : No (Rating: 0)**

**3. Are there any trails at the campground? : No (Rating: 0)**

**4. Is there a beach, dock/fishing platform or boat launch? : No (Rating: 0)**

**Additional comments regarding assessment:** : There are no advertised or designated camping features at Fisheries Pool campground. However 9 RV/trailer campsites, the shelter, and the trash receptacle are already fairly accessible. The main features of this campground are a small beach and a popular fishing area. These are not at all accessible and the route to view these areas is blocked by large strategically placed rocks (less than 1 metre apart).



**Description of Photo 1 :** Accessible Picnic Shelter with fireplace



**Description of Photo 2 :** Accessible water pump



**Description of Photo 3 :** Fisheries Pool campground - restricted access to river (less than 1 metre between rocks).

Water Access

Goods and Services